



Vehicle information


Make:	MINI	License:	GM536PE
Gearbox:		Body color:	
Model:	M	VIN:	WMW21BS0603P78118
Fuel type:	Plug-in hybrid	Power:	
Version:	MINI Countryman	First registration	08/03/2023
Mileage:	33516 km	N° of doors:	

Damage summary

Front	1
Left	3
Rear	2
Right	2
Roof & others	1
Wheels	2

Commercial pictures



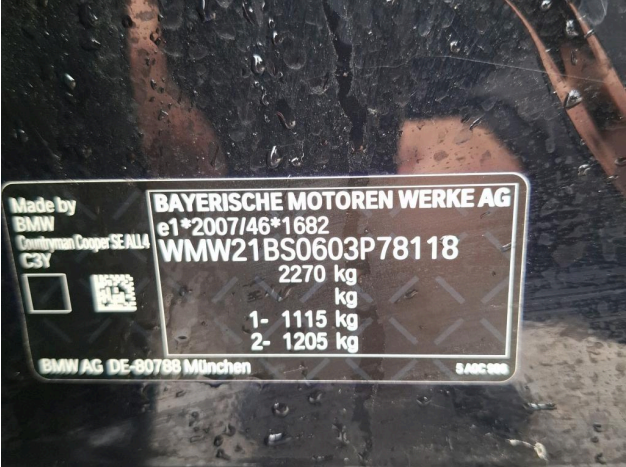

Options according to the inspector

No option checks information found

Damages

Alloy rim FL
Scratch(es)
Acceptable
Wheels



Alloy rim FR
Scratch(es)
Repair/replace (lump sum)
Wheels



Bodywork
Paint measurement
Acceptable
Roof & others



Bumper moulding R

Scratch(es)
Replace
Rear



Bumper R

Scratch(es)
Paint
Rear



Bumper spoiler F

Scratch(es)
Replace
Front



Door FL

Scratch(es)
Acceptable
Left



Door FR

Dent(s) and scratch(es)
Repair and paint (complete)
Right



Door RL

Scratch(es)
Polish
Left



Door RR

Scratch(es)
Polish
Right



Wing trim RL

Scratch(es)
Acceptable
Left



Tyres

Front Left

Summer
225/55/17/97/W
Kleber
6.2 mm

Front Right

Summer
225/55/17/97/W
Kleber
6.2 mm

Rear Left

Summer
225/55/17/97/W
Goodyear
7.0 mm

Rear Right

Summer
225/55/17/97/W
Goodyear
6.9 mm

Checks			
Category	Passenger Car	Engine functioning	Yes
Jack	N/A	Luggage cover	Yes
Number head rests	5	Number keys remote	2
Number of keys total	2	Registration Certificate	Yes
Registration Certificate	Original		

Information on the content and the scope of the inspection report:

- The assessment is based on the sales standards specified by the customer.
- Acceptable usage damages according to the sales standards are not always documented in this status report.
- The specified repair methods and/or resulting repair times have been determined, taking into account modern industrial repair methods.
- The purchasing dealer should assess individual repair costs.
- The inspection was carried out in a non-disassembly condition. Macadam cannot be held responsible for any missing information. For further information, please contact the seller.